

RF-Capacitance / Admittance Level Switch





## PRODUCT INTRODUCTION

#### PRODUCT DESCRIPTION

RF-Capacitance /Admittance level switch is appropriate for application in liquid and solid mediums. It is designed to reduce medium attaching to the probe. This product also offers DPDT output, high/low level failsafe, adjustable time delay, and sensitivity adjustment. Various models are available for high temperatureerature,or limited space environments.

#### **FEATURES**

- Time delay function from 0-30 seconds
- IP65 housing protection
- 5 A/250Vac output DPDT
- High/low failsafe
- Alarm testing
- Explosion Proof model available

#### **WORKING PRINCIPLE**


RF-Capacitance /Admittance level switch consists of a guard section, upper insulation, main probe and grounding. The guard section is designed to overcome possible medium attachment and to secure signal accuracy. The special structure is suitable for detecting different mediums without being affected by attachments.

The upper main probe, guard, and grounding are all insulated. The level of the medium can be detected by the increasing of admittance when medium reaches the main probe.

The grounding and the main probe are insulated, thus the device will still function accurately and not cause false alarms when the medium attaches the probe.

#### **FEATURES**

- Anti-Viscosity
- Easy Installation
- Stable; Not affected by temperatureerature
- Highest temperatureerature tolerance of 550°C
- Explosion-proof 450°C
- Applicable in liquid, syrup, solid, powder, and surface level detection

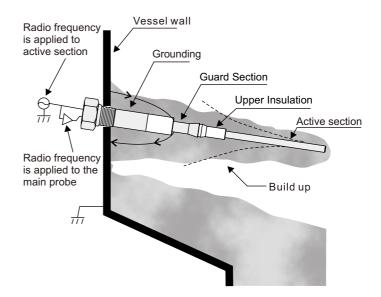




## **CONSTRUCTION & APPLICATION**

#### CONSTRUCTION

- 1. Main probe: SUS304 or SUS316
- Upper Insulation: The upper insulated part of the main probe and guard section have very low k die-electric constants and are made of PTFE or PEEK
- 3. Guard Section: The conductive metal probe helps to dissipate any possible presence of a false signal.
- Lower Insulation: Due to the low k die-electric constant nature of the main probe, it is comprised of PTFE

- 5. Connection: 3/4"NPT(Standard model)
- 6. Housing: Aluminum Alloy Spray Paint
- 7. Wiring Point: 1/2" PT
- 8. Waterproof O-Ring: Rubber
- 9. Circuitry: FSH and FSL, Time Delay Adjustable Function

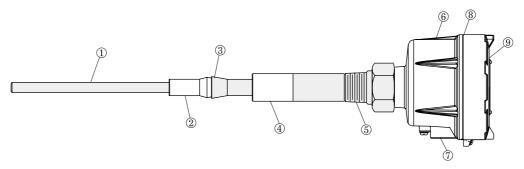


#### **APPLICATION**

Storage Tanks, Containers, Wells, Reservoirs and bins containing any liquids, powders or pellets that require precise level detection and control. Key industries include:

- Breweries
- Mining
- Paint Manufacturing Cement
- Coalt
- Food Processing
- Flour Mills
- Glass Industry
- Plastics Engineering, Polymers and synthetics

- Paper Manufacturing
- Power Plants
- Water Treatment and Waste
- Tar
- Food and beverages industries

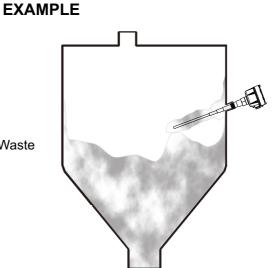

2100/2110: Standard Model ----- Applicable to normal environments.

2200: Hi-Temperature Model -----Applicable to high temperature environments.

2280: Super Hi-Temperature Model -----Applicable to super high temperature environments.


2500: Cable Model -----Applicable to big tank and top installation environments.

2600: Mini Model -----Applicable to space constraint and small tanks.

17□□: Explosion Proof Type ---- Ex d IIB T6~T1 Gb



## **SPECIFICATIONS**

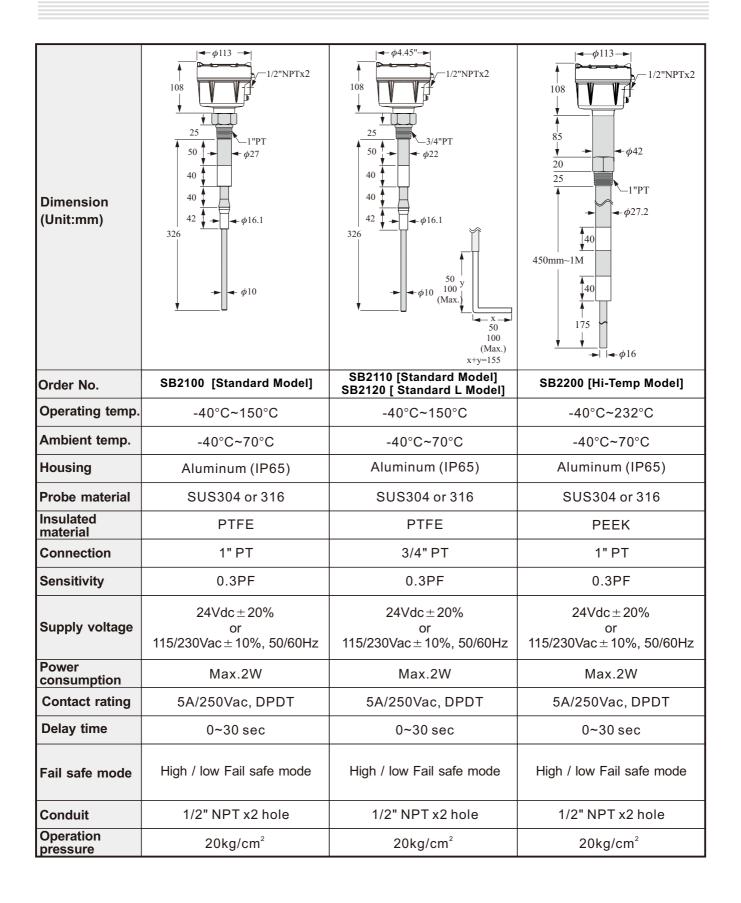



Dimension (Unit:mm)	200 200 200 4 50 4 580 25 38 20 4 4 4 4 4 4 51 51 51 51 51 51 51 51 51 51	25 1"PT	- φ113 - 1/2"NPTx2  108 - 3/4"PT - 20 - φ21.7 - 60 - φ21.6 - φ16
Order No.	SB2280 [Super Hi-Temp Model]	SB2500 [Cable Model]	SB2600 [Mini Model]
Operating temp.	-40°C~550°C	-40°C~150°C	-40°C~150°C
Ambient temp.	-40°C~70°C	-40°C~70°C	-40°C~70°C
Housing	Aluminum (IP65)	Aluminum (IP65)	Aluminum (IP65)
Probe material	SUS304 or 316	SUS304 or 316	SUS304 or 316
Insulated material	Ceramic	PTFE	PTFE
Connection	1-1/4" PT	1" PT	3/4" PT
Sensitivity	0.3PF	0.3PF	0.3PF
Supply voltage	24Vdc ± 20% or 115/230Vac ± 10%, 50/60Hz	24Vdc±20% or 115/230Vac±10%, 50/60Hz	24Vdc ± 20% or 115/230Vac ± 10%, 50/60Hz
Power Consumption	Max.2W	Max.2W	Max.2W
Contact rating	5A/250Vac, DPDT	5A/250Vac, DPDT	5A/250Vac, DPDT
Delay time	0~30 sec	0~30 sec	0~30 sec
Fail safe mode	High / low Fail safe mode	High / low Fail safe mode	High / low Fail safe mode
Conduit	1/2" NPT x2 hole	1/2" NPT x2 hole	1/2" NPT x2 hole
Operation pressure	ATM	20kg/cm <sup>2</sup>	20kg/cm <sup>2</sup>



## **SPECIFICATION**

Dimension (Unit:mm)	25 108 17 1/2"NPTx2  108 27 40 40 42 42 42 40 416.1	25 3/4"PT 50 + \phi 22 40	φ113 — 1/2"NPTx2  108  108  108  420  25  1"PT  440  450mm~1M  440  175  40  175  40  175  40  175  40  175  40  175  40  175	
Order No.	SB1710 [Standard Model]	SB1711 [Standard Model] SB1712 [ Standard L Model]	SB1720 [Hi-Temp Model]	
Operating temp.	-40°C~150°C	-40°C~150°C	-40°C~232°C	
Ambient temp.	-20°C~70°C	-20°C~70°C	-20°C~70°C	
Housing	Aluminum (IP65)	Aluminum (IP65)	Aluminum (IP65)	
Probe material	SUS304 or 316	SUS304 or 316	SUS304 or 316	
Insulated material	PTFE	PTFE	PEEK	
Connection	1" PT	3/4" PT	1" PT	
Sensitivity	0.3PF	0.3PF	0.3PF	
Supply voltage	24Vdc±20% or 115/230Vac±10%, 50/60Hz	24Vdc±20% or 115/230Vac±10%, 50/60Hz	24Vdc±20% or 115/230Vac±10%, 50/60Hz	
Power consumption	Max.2W	Max.2W	Max.2W	
Contact rating	3A/250Vac, DPDT	3A/250Vac, DPDT	3A/250Vac, DPDT	
Delay time	0~30 sec	0~30 sec	0~30 sec	
Fail safe mode	High / low Fail safe mode	High / low Fail safe mode	High / low Fail safe mode	
Conduit	1/2" NPT x2 hole	1/2" NPT x2 hole	1/2" NPT x2 hole	
Operation pressure	20kg/cm <sup>2</sup>	20kg/cm <sup>2</sup>	20kg/cm²	




Dimension (Unit:mm)	200 200 200 200 200 4 580 25 38 4 20 4 4 4 4 50 4 4 50 4 50 4 50 4 50 4 50 4 50 4 50 4 50 4 50 5 50 6 50 7 50 7	25 1/2"NPTx2  108 25 1"PT 40 40 42 40 42 40 42 40 42 40 42 40 42 40 40 42 40 40 42 40 40 42 40 40 42 40 40 42 40 40 40 40 40 40 40 40 40 40 40 40 40	-φ113 - 1/2"NPTx2  108 -3/4"PT 20 -3/4"PT 60 -φ21.7 60 -φ16
Order No.	SB1728 [Super Hi-Temp Model]	SB1750 [Cable Model]	SB1760 [Mini Model]
Operating temp.	-40°C~450°C	-40°C~150°C	-40°C~150°C
Ambient temp.	-20°C~70°C	-20°C~70°C	-20°C~70°C
Housing	Aluminum (IP65)	Aluminum (IP65)	Aluminum (IP65)
Probe material	SUS304 or 316	SUS304 or 316	SUS304 or 316
Insulated material	Ceramic	PTFE	PTFE
Connection	1-1/4" PT	1" PT	3/4" PT
Sensitivity	0.3PF	0.3PF	0.3PF
Supply voltage	24Vdc ± 20% or 115/230Vac ± 10%, 50/60Hz	24Vdc±20% or 115/230Vac±10%, 50/60Hz	24Vdc±20% or 115/230Vac±10%, 50/60Hz
Power consumption	Max.2W	Max.2W	Max.2W
Contact rating	3A/250Vac, DPDT	3A/250Vac, DPDT	3A/250Vac, DPDT
Delay time	0~30 sec	0~30 sec	0~30 sec
Fail safe mode	High / low Fail safe mode	High / low Fail safe mode	High / low Fail safe mode
Conduit	1/2" NPT x2 hole	1/2" NPT x2 hole	1/2" NPT x2 hole
Operation pressure	ATM	20kg/cm <sup>2</sup>	20kg/cm <sup>2</sup>



## WIRING DIAGRAMS

#### **DESCRIPTION OF PANEL FUNCTION**

- Set Point: Clockwise, capacitance increases.
- 2 Red LED: Power indicator.
- Range: Alarm setting- HI/LOW
- FSH/FSL switch (High/Low level failsafe)
- **5** Green LED: Alarm indicator for FSH and FSL. Green LED turns off when alarm goes off.
- Time Delay: Alarm time delay setting up to 30 seconds. Time Delay: Alarm time delay setting up to 30 seconds.
- Alarm simulation testing.(SB2□□□Aseries)
- Relay output.

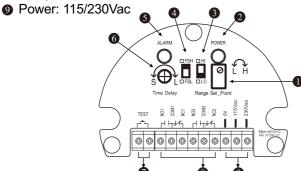

#### **FAILSAFE ALARM**

#### FSH high level failsafe alarm:

SB2 series switch is installed at the high level point the FSH switch mode is "on".

When the medium has no contact with the probe, the green LED lights up and relay output COM/NC is in an open state.

When the medium level reaches high level and it touches the probe (or in the case of blackout), the green LED turns off and the relay output COM/NC is closed. When the relay output COM/NC is closed, it implies the FSH alarm has been activated.


#### ALARM CALIBRATION

#### **Setting for High Level Alarm**

- 1.Switch the FSH/FSL Knob to FSH
- 2.Switch the Range Knob to LO.
- 3.Switch the Time Delay Knob to S (Minimum).
- 4.Decreasing the level of the medium to below the measuring probe.
- 5. Spinning the Set Point Knob till the Alarm LED (green light) lights up.
- 6. Firstly, increasing the level of the medium till it covers half of he measuring probe and the Alarm LED (green light) shut off. Secondly, spinning the Set Point Knob clockwise till Alarm LED (green light) lights up. If the Alarm LED (green light) still not lights up after spinning it till the end, please adjust the Range Switch to HI and repeat procedure 5. Thirdly, recording the numbers of turns and its angle, then switching the knob counterclockwise back for 1/2 circle and angle.
- 7. Adjusting the delay time for alarm (0~30 seconds): If turning the Time Delay Knob clockwise, the delay time is postponed, while turning the Time delay Knob counterclockwise, the delay time is shorten.

#### DESCRIPTION OF PANEL FUNCTION

- Set Point: Clockwise, capacitance increases.
- 2 Red LED: Power indicator.
- Range: Alarm setting- HI/LOW
- FSH/FSL switch (High/Low level failsafe)
- **5** Green LED: Alarm indicator for FSH and FSL. Green LED turns off when alarm goes off.
- ♠ Alarm simulation testing.(SB2□□□B series)
- Relay output.

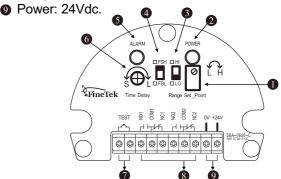

#### FSL low level failsafe alarm:

SB2 series switch is installed at the low level. the FSL mode is "on".

When the medium touches the probe the green LED lights up and the relay output COM/NC is in an open state.

When the medium level drops below the low level and the medium does not have contact with the probe (or in the case of blackouts), the green LED turns off and relay output COM/NC is closed.

When relay output COM/NC is closed, it implies the FSL alarm has been activated.

#### Setting for Low Level Alarm

- 1. Move the FSH/FSL button to FSL.
- 2. Move the 'range' button to LO.
- 3. Turn the 'time delay' knob to S (Minimum).
- 4. Lower the level of the medium to cover half of the measuring probe.
- 5. Turn the 'set point' screw counterclockwise till the Alarm LED lights up. If the LED hasn't lit up after turning it fully to the end, please adjust the 'range' button to HI and repeat procedure 5.
- 6. Now, decrease the level of the medium until it is below the measuring probe and the Alarm LED has turned off.
  - Next, turn the 'set point' screw counterclockwise until the Alarm LED (green light) lights up [Recording the numbers of turns you make]. Finally, turn back the set point screw clockwise for 1/2 circle.
- 7. Adjust the delay time for the alarm (0~30 seconds): When turning the 'time delay' knob clockwise, the delay time is postponed. Turning the 'time delay' knob counterclockwise, the delay time will be shortened.



## **HOW TO ORDER**

SB 2			
	$\neg$		

#### Order No. —

10: Standard Model(1"PT)

11/12: Standard Model/Standard LModel(3/4"PT)

20: Hi-Temperature Model(232°C)

**28:** Super Hi-Temperature Model(550°C)

50: Cable Model60: Mini Model

#### MATERIAL -

0: SUS304 6: SUS316 L: SUS316L

#### POWER -

**A:**115/230Vac 10%, 50/60Hz--- Analog alarm function

B: 24Vdc 20%--- Analog alarm function

C:115/230Vac 10%, 50/60Hz

**D**: 24Vdc 20%

#### Connection —

Dimens	sion	Specifi	ication
C3/4"(20A)* D1"(25A) 31-1/4"(32A) E1-1/2"(40A) F2"(50A) G2-1/2"(65A) *3/4" connection is SB2100, 2110, 212		M5kg/cm <sup>2</sup> N10kg/cm <sup>2</sup> O150 Lbs P300 Lbs WPN 10 XPN 16 YPN 25	ZPN 40 QPT RPF TBSP UNPT VGAS S—Others

#### Probe Length (unit: mm) -


**0500**: below 500mm **1000**: 501~1000mm

\* Use letters for the code beginning for probelengths over 10m.
 A150 represents 15m, A200 represents 20m

- \* Margin of error of the total product length is  $\pm 5$ mm.
- \* Characteristics, specifications and dimensions are subject to change.
- \*Please contact your nearest distributor for further information.



## **HOW TO ORDER**

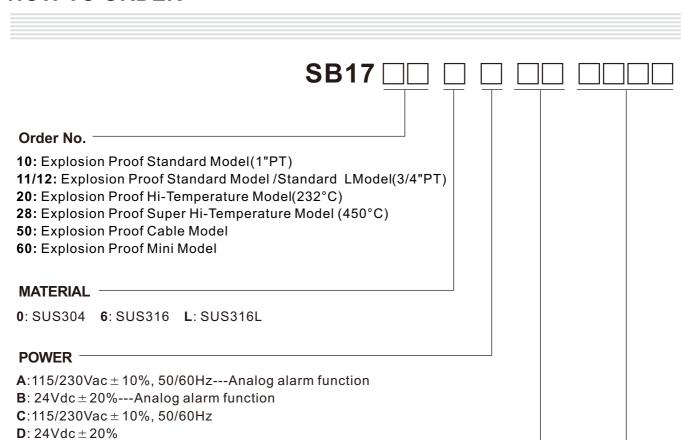

#### Connection —

Dimension		Specification	1
C3/4"(20A)* H3"( D1"(25A) I4"(1 31-1/4"(32A) J5"( E1-1/2"(40A) K6"( F2"(50A) SOtl G2-1/2"(65A)  *3/4" connection is only ava SB1711, 1712, 1760.	00A) N1( 25A) O1( 150A) P3( WP) XPI	0kg/cm² Q 50 Lbs R 00 Lbs TI N 10 U N 16 V	PF

#### Probe Length (unit: mm) -

**0500:** below 500mm **1000:** 501~1000mm

W Use letters for the code beginning for probe lengths over 10m.
 A150 represents 15m, A200 represents 20m

- \* Margin of error of the total product length is  $\pm 5$ mm.
- \* Characteristics, specifications and dimensions are subject to change.
- \* Please contact your nearest distributor for further information.



# Global Network



#### Asia

#### Taiwan

FINETEK CO., LTD. - Taipei Head Quarter No.16, Tzuchiang St., Tucheng Industrial Park

New Taipei City 236, Taiwan TEL: 886-2-2269-6789 FAX: 886-2-2268-6682 EMAIL: info@fine-tek.com

FINETEK CO., LTD. - I-Lan Factory

TEL: 886-3-990-9669 FAX: 886-3-9909659

FINETEK CO., LTD. - Taichung Brance

TEL: 886-4-2337-0825 FAX: 886-4-2337-0836

FINETEK CO., LTD. - Kaohsiung Branch

TEL: 886-7-333-6968 FAX: 886-7-536-8758

#### China

FINE AUTOMATION CO., LTD. - Shanghai Factory No.451 DuHui Rd, MinHang District, Shanghai,

China 201109 TEL: 86-21-6490-7260 FAX: 86-21-6490-7276 EMAIL: info.sh@fine-tek.com

#### Singapore

FINETEK PTE LTD. - Singapore Office No. 60 Kaki Bukit Place, #07-06 Eunos Techpark 2 Lobby B, Singapore 415979

TEL: 65-6452-6340 FAX: 65-6734-1878 EMAIL: info.sg@fine-tek.com

#### ■ North America

#### California, U.S.

APLUS FINETEK SENSOR INC. - US Office 355 S. Lemon Ave, Suite D, Walnut, CA 91789

TEL: 1 909 598 2488 FAX: 1 909 598 3188 EMAIL: info@aplusfine.com

#### Illinois, U.S.

APLUS FINETEK SENSOR INC. TEL: 1 815 632-3132

FAX: 1 815 716 8464 EMAIL: info@aplusfine.com

#### Europe

#### Germany

FineTeK GmbH - Germany Office Frankfurter Str. 62, OG D-65428 Ruesselsheim, Germany TEL: +49-(0)6142-17608-0 FAX: +49-(0)6142-17608-20

EMAIL: info@fine-tek.de

FineTek

Distributor:	